


Instructions for Installing WATCO Innovator® Bath Wastes

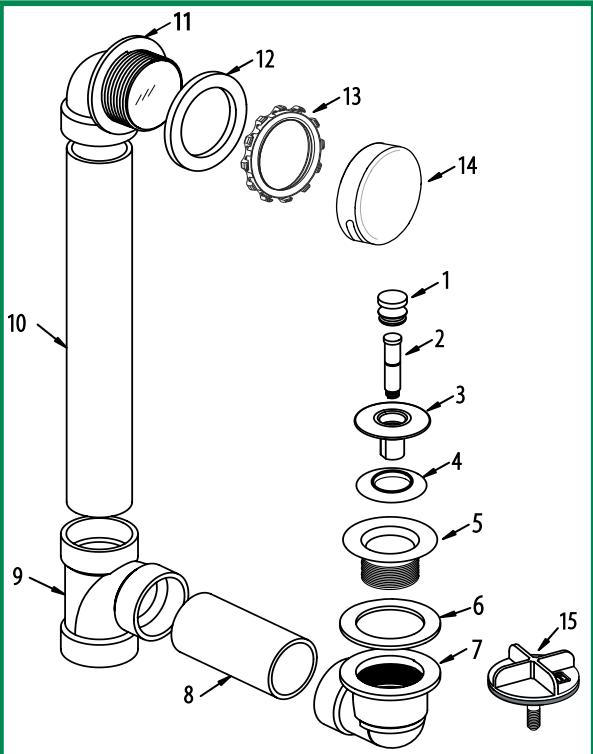

Step 1: Cut the 1½" Schedule 40 pipes (**Item 8 and Item 10**) to the desired lengths to fit the tub.

Step 2: Using the proper solvent cement, assemble the bath drain pipes and fittings (**Item 7 thru Item 11**).

Step 3: Place foam gasket (**Item 12**) onto overflow elbow (**Item 11**).

Step 4: Insert overflow elbow and foam gasket assembly into the tub overflow hole from the back of the tub.

Step 5: Screw on retainer nut (**Item 13**) from inside of tub. **HAND-TIGHTEN ONLY.**

Step 6: Secure drain elbow (**Item 7**) and drain flange gasket (**Item 6**) under the tub by screwing in the strainer body (**Item 5**) through tub drain hole from inside the tub.

If not testing the bath waste, skip to Step 8.

Step 7: Screw the strainer test plug (**Item 15**) into the strainer body (**Item 5**) and test the system. Once testing is complete, remove the strainer test plug (**Item 15**).

Step 8: Cut away the orange test membrane from the overflow elbow (**Item 11**).

Step 9: Snap on the overflow plate (**Item 14**) with the slot facing downward.

Step 10: Install the stopper assembly (**Item 1 thru Item 4**) into the strainer body (**Item 5**).

Note: Items 1 thru 4 may vary depending on the type of stopper assembly being used.



Always A Step Ahead

Innov. Inst. Rev. 6/09

WATCO MANUFACTURING COMPANY

1220 South Powell Road • Independence, MO 64057-2724

Phone: 816-796-3900 • 800-821-8576

Fax: 816-796-0875 • 800-399-2826

www.watcomfg.com